

Invoice

BILL TO

Beth Monsour
1905 S Holly Ln
Tampa, FL 33629

JOB SITE

Beth Monsour
1905 S Holly Ln
Tampa, FL 33629

BALANCE DUE

\$0.00

DESCRIPTION OF WORK	QUANTITY	PRICE	TOTAL
Residential Pool Leak Detection	1	\$375.00	\$375.00

- Includes testing of the pool shell, plumbing lines and equipment
- 60 day warranty
- Once your Leak Detection is complete, you automatically earn a **\$50 credit toward any repairs** you choose to schedule with us

Note: Bodies of water can lose up to a 1/4 inch a day from evaporation under normal operating conditions.

Disclaimer: Fees for services will apply if water loss is due to evaporation.

Subtotal:	\$375.00
Tax:	\$0.00
Payments:	\$375.00

Balance Due: \$0.00

Payment History

DATE	PAYMENT TYPE	STATUS	CC LAST FOUR	DESCRIPTION	NOTES	AMOUNT
------	--------------	--------	--------------	-------------	-------	--------

May 20, 2025	Paid	1019	\$375.00
--------------	------	------	----------

Results & Findings

☒ Thursday, May 15, 2025 appointment

Pool Status

Confirmed water level is holding solid. The pool is not leaking. Evaporation and equipment leak.



☒ Wednesday, May 14, 2025 appointment

Areas of Concern

Found existing epoxy patch:

- In and around the light
- Around the return
- In the tile
- In and around the vac line

Epoxy patches can be an indication of previous leaks that could open up in the future, initiating further water loss.

Epoxy patches are an indication of previous leaks that could open up in the future as the patch wears away, initiating further water loss. Recommend proper repair.

Additional Notes:

Wall port closed with Epoxy




Equipment

Deck: Pavers

Surface:

Pebble tec

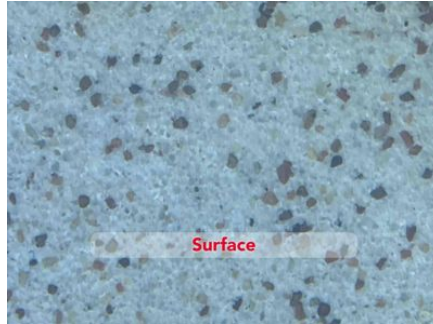

Miscellaneous



Pool Status

The equipment will leak, as identified in the findings, until it is fixed by a pool service professional.



Test Related


Performed a complete dye test.



All lines are holding solid

Additional Notes:

Alternative testing on all returns Passed

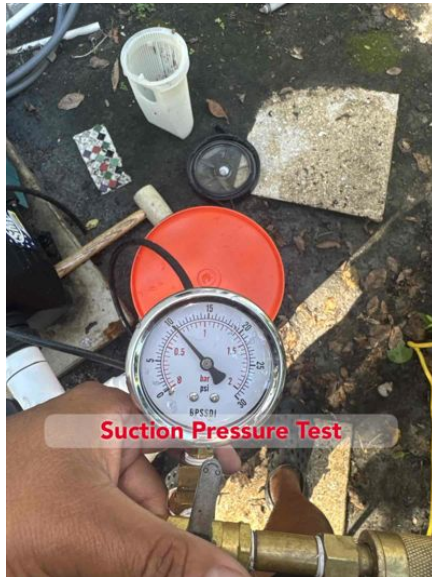


Water level marked in: Zero

Results will be confirmed by: Phone call


Date of confirmation: 2025-05-15

Additional Notes:

Pump off

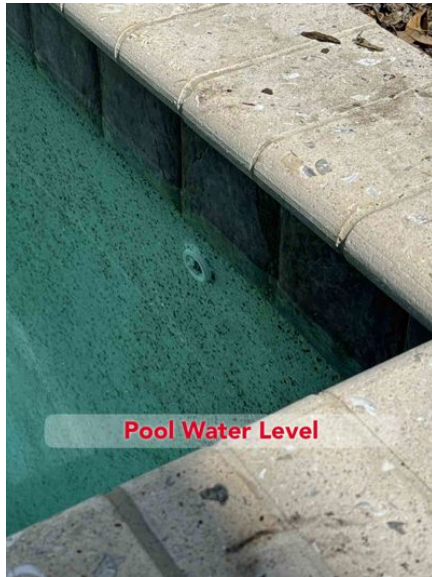

Pool Water Level

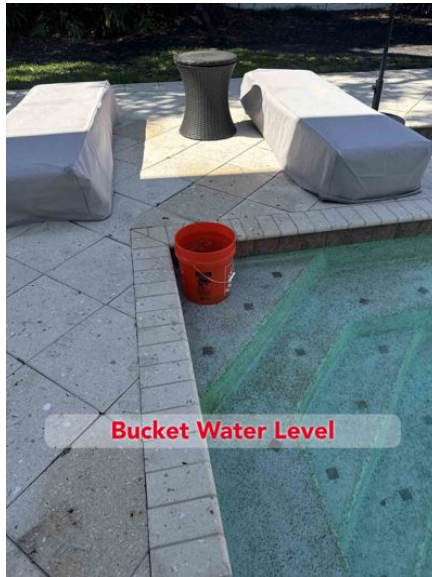

Bucket Water Level



Warranties & Disclaimers



Payment is expected at time of service. License #CPC1457457

Note:

Customer is responsible for refilling water and balancing chemicals. Please monitor water levels for 48 hours. Contact RRLD with any questions or concerns.

Change Order Disclaimer:

A change order will be issued if RRLD discovers any unforeseen or unexpected work not specified above. An additional quote will be issued at that time.

Deck Disclaimer:

RRLD does not offer custom staining or textures. We will make every attempt to match the deck when applying deck patches. If an exact match is desired (color and texture), customer will need to hire a professional deck company to apply the patch.

Patch Disclaimer:

Red Rhino Leak Detection (RRLD) will make every attempt to match the existing surface when applying patches. However, due to variations of the product from the manufacturer and aging of the existing surface, it is impossible to achieve an exact match when patching. Refinishing the entire surface is the only way to ensure a consistent appearance without variation. Therefore, RRLD cannot be held responsible for color and texture variations which are unavoidable when patching.

Sign Invoice

Please sign and date below for approval and return via email(redrhinocsr@redrhino.com) or fax(561-692-4814). All scheduling is on a first come first serve basis. We will contact you regarding scheduling upon receipt of the signed document

X

Date

Printed Name